


TRCD CM	DRWN CM	CHKD CM	ENGINEERS	APPROVED	ISSUE	22-9-28 CODE OF BANK WAS C103A. CONNECTIONS TO ROWH(A) & WIPER(A) OF SELECTOR WERE TO ROWH(A) & WIPER (1) RESPECTIVELY. TIMES OF DELAY PERIODS WERE DIFF. A 30-11-28 C103D SEL <sup>S</sup> WAS C113D, C113 BANK WAS C107A, CONN <sup>N</sup> BETWEEN TD 8 & 9 WAS NOT SHOWN. B 18-12-29 CODE OF TD RELAY WAS C6783T. CONN <sup>N</sup> BANK C TO U16 & TRC WAS VIA SPGS OF TD. C 7-2-30 FTC & DMC WERE TO EARTH. FTG WAS TO FTB. DNG WAS TO DM1. D 14-7-30
------------	------------	------------	-----------	----------	-------	---

G.E.C. LTD TEL. WKS. COVENTRY.

50 V. RAX. SYSTEM.

COMMON ALARM CIRCUIT.

16780  
DUPLICATE TRACING.

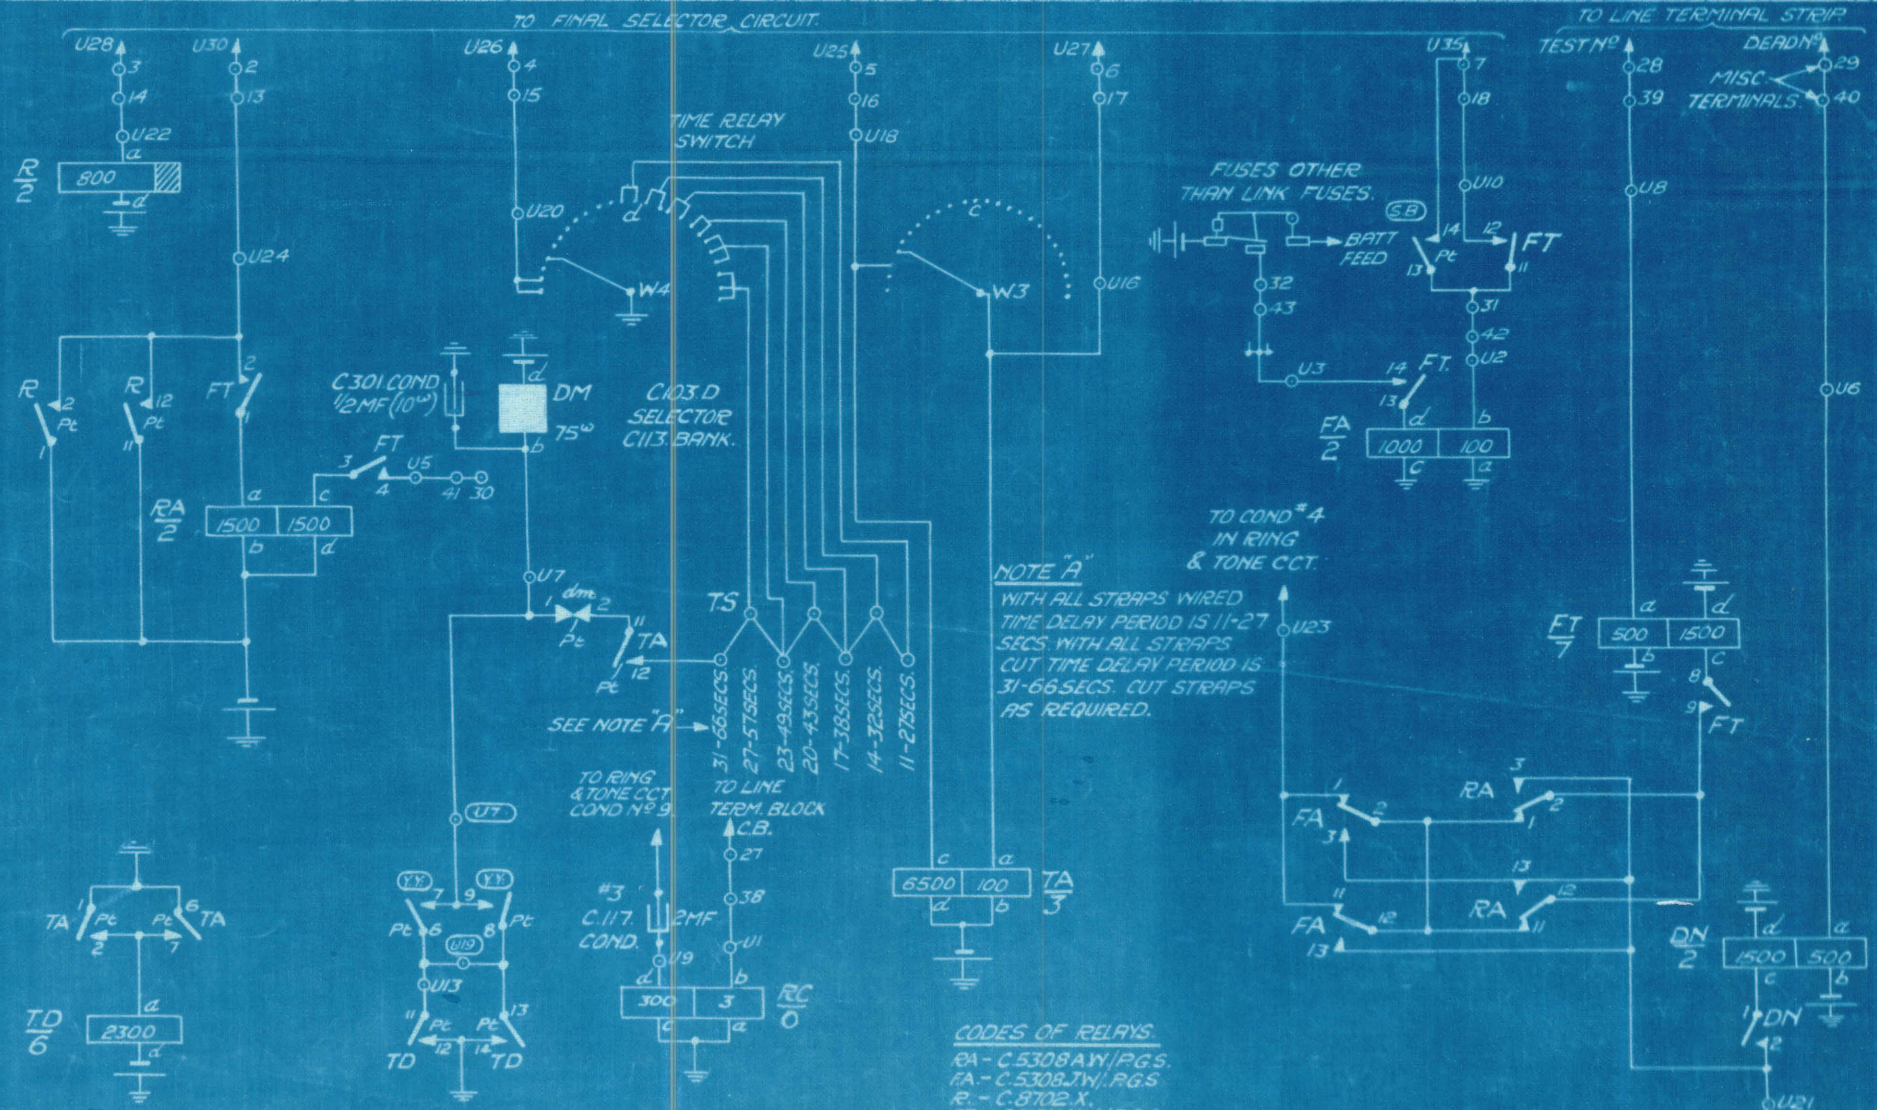

NOTE "A"  
WITH ALL STRAPS WIRED TIME DELAY PERIOD IS 11-27 SECS. WITH ALL STRAPS CUT TIME DELAY PERIOD IS 31-66 SECS. CUT STRAPS AS REQUIRED.

CODES OF RELAYS.  
RA - C.5308AW/R.G.S.  
FA - C.5308TW/R.G.S.  
R - C.8702.X.  
FT - C.7611.H.W./R.G.S.  
TA - C.6813.S.  
DN - C.5302.H.W./R.G.S.  
TD - C.6743.T.

(YY) REFERS TO RELAY ON RING & TONE CCT.

P.O. APPL. 2-11-28.  
MADE FOR:-  
GPO STANDARD.  
REF:- 5.467.

WIR DIAG:- 16781.

PL DENOTES PLATINUM CONTACTS.

TO COND #9 IN RING & TONE CCT.